

Product Change Notification

(Notification - P1803015-DIG) (DOP001/ HMRL-AC-17-0016 / 3)

March 30, 2018

To: Our Valued Digi-Key Customer

Overview: The purpose of this notification is to communicate a product change of select Renesas Electronics

America, Inc. (REA) devices.

This notification announces one or more of the following changes to select RL78 L12/L13 devices (see Appendix 2 for details of the specific change).

- 1. Addition of Saijyo as a wafer fabrication site
- 2. Addition of RSB as an assembly site
- 3. Addition of RSB as a final test site
- 4. Package Dimensional Tolerance specification change
- 5. Lead Frame Die Pad shape change
- 6. Die Mount material change
- 7. Bonding Wire change from Gold (Au) to Copper (Cu)
- 8. Mold Resin material change
- 9. Top Mark visibility change
- 10. Desiccant change
- 11. Embossed Tape storage number change

There is a part number change. There is no change in product specifications and/or characteristics. There is no impact to quality and/or reliability.

Affected Products:

A review of our records indicates the attached list (see Appendix 1) of products may affected your company.

Part numbers given in this list are for active part numbers in REA database at the time of this notification.

Key Dates:

Shipments from REA of replacement products begins.

Aug. 1st, 2018

Response:

No response is required. REA will consider this notification approved 30 days after its issue. If you anticipate volumes beyond your regular rate prior to the transition date, please contact your REA sales representative with a forecast of your requirements.

You are encouraged to sample the suggested replacement device and begin qualification as soon as possible. Please contact you REA sales representative to obtain samples.

If the customer provides a timely acknowledgement, the customer shall have 90 days (an additional 60 days) from the date of receipt of this notification in which to make any objections to the notification. If the customer does not make any objections to this notification within 90 days of the receipt of the notification, then Renesas will consider the notification as approved. If customer cannot accept the notification, then the customer must provide Renesas with a last time buy demand and purchase order.

Please contact your REA sales representative for any questions or comments.

Thank you for your attention.

Sincerely,

Renesas Electronics America, Inc.



Appendix 1: Digi-Key Part Number List

Booking Part Number	Replacement PN	PCN Notes for Customer Notification
R5F10RG8GFB#V0	R5F10RG8GFB#30	1. Addition of Saijyo as a wafer fabrication site;
R5F10RGAGFB#V0	R5F10RGAGFB#30	2. Addition of RSB as an assembly site; 3. Addition of RSB as a final test site;
R5F10RGCGFB#V0	R5F10RGCGFB#30	4. Package Dimensional Tolerance specification change;5. Lead Frame Die Pad shape change;6. Die Mount material change;
R5F10RLAGFB#V0	R5F10RLAGFB#30	7. Bonding Wire change from Gold (Au) to Copper (Cu); 8. Mold Resin material change;
R5F10RLCGFB#V0	R5F10RLCGFB#30	9. Top Mark visibility change;
R5F10RG8GFB#X0	R5F10RG8GFB#50	 Addition of Saijyo as a wafer fabrication site; Addition of RSB as an assembly site; Addition of RSB as a final test site;
R5F10RGAGFB#X0	R5F10RGAGFB#50	 4. Package Dimensional Tolerance specification change; 5. Lead Frame Die Pad shape change; 6. Die Mount material change; 7. Bonding Wire change from Gold (Au) to Copper (Cu);
R5F10RGCGFB#X0	R5F10RGCGFB#50	8. Mold Resin material change; 9. Top Mark visibility change; 10. Desiccant change;
R5F10RLAGFB#X0	R5F10RLAGFB#50	 Addition of Saijyo as a wafer fabrication site; Addition of RSB as an assembly site; Addition of RSB as a final test site; Package Dimensional Tolerance specification change; Lead Frame Die Pad shape change;
R5F10RLCGFB#X0	R5F10RLCGFB#50	 6. Die Mount material change; 7. Bonding Wire change from Gold (Au) to Copper (Cu); 8. Mold Resin material change; 9. Top Mark visibility change; 10. Desiccant change; 11. Embossed Tape storage number change;



Appendix 2: Change Details

DIFFERENCE OF SPECIFICATION (RL78/L12, L13)

WAFER FABRICATION: KAWASHIRI → KAWASHIRI/SAIJO, ASSEMBLY: RSKL → RSB, SORTING: RSKL → RSB,

BONDING WIRE: Au → Cu

MARCH.13, 2018

BROAD-BASED SOLUTION BUSINESS UNIT RENESAS ELECTRONICS CO., LTD.

TECHNOLOGY DIVISION RENESAS SEMICONDUCTOR PACKAGE & TEST SOLUTIONS CO., LTD.

HMRI -AB-17-0170

© 2017 Renesas Electronics Corporation. All rights reserved



Notice

- Notice

 1. Descriptions of circuits: software and other related information in this document are provided only to illustrate the operation of semiconductor products and application examples. You are fully responsible for the incorporation of any other uses of this droit, software, and information of the product of system. Renesas Electronics doctains any and all liability for any responsible for the incorporation of the product of systems. Comprising for the use of Renesas Electronics between the product of systems, copyrights or other intellectual property rights of third parties, by or arising from the use of Renesas Electronics products or technical information described in this document, including but not limited to, the product data, drawings, charts, programs, algorithms, and application examples in the product of systems and pulpication examples in the product of systems and the product of systems and pulpication examples in the product of systems and the product of syste

(Rev. 4.0-1 November 2017)





Outline

Addition of wafer fabrication factory:
 Current factory: Renesas Semiconductor Manufacturing Kawashiri 8 inch line
 Additional factory: Renesas Semiconductor Manufacturing Saijo 8 inch line

Addition of assembly factory:
 Current factory: Renesas Semiconductor KL Sdn. Bhd., (RSKL)
 Additional factory: Renesas Semiconductor (Beijing) Co., Ltd. (RSB)

Addition of sorting factory:
 Current factory: Renesas Semiconductor KL Sdn. Bhd., (RSKL)
 Additional factory: Renesas Semiconductor (Beijing) Co., Ltd. (RSB)

- Change of material: 1) Bonding wire, 2) Resin, 3) Lead frame, 4) Die mount
- Addition of package outline:
 Assembly factory is added, and the package outline form is also added.
 But there is no change for a footprint.
- Change of ordering Part Number:
 The products which are changed the bonding wire from Gold (Au) to Copper (Cu) are changed the ordering Part Number as follows.
 Current part number: R5F1*******#V0, R5F1*******#X0
 New part number: R5F1*******#30, R5F1*******#50
- Change of marking: Changes at assembly factory
- Packing specification: A part of Packing material is changed
- Specification and characteristics of product: No change
- Quality and reliability: No change

© 2017 Renesas Electronics Corporation. All rights reserved.

Page :



Difference of specification

Item		Current	New	
Wafer fabrication factory		Kawashiri	Kawashiri / Saijo	
Assemb	ly factory	RSKL	RSB	
Sorting	g factory	RSKL	RSB	
Package	Outline	Change (Refer	to pages 5 to 8)	
Lead frame	Material	No c	hange	
Lead Ifame	Inner pattern	Change (Refer to page 9)		
Die mount	Material	Ag epoxy paste B	Ag epoxy paste A	
Bonding wire	Material	Au	Cu (Pd coating)	
Resin	Material	Resin B-1 (halogen-free)	Resin A-2 (halogen-free)	
Plating	Material	No c	hange	
Font Change (Refer to page 10)		er to page 10)		
Marking Digit number		Change (Refer to pages 11,12)		
Packing	Tray/ Emboss tape	Change (Refer to page 13)		


X There is no impact on reliability and specification by material change.

^{*} The contents of PC-WRP-A001C are not included in the difference.





Difference of Outline Dimension_10mm×10mm 64pin

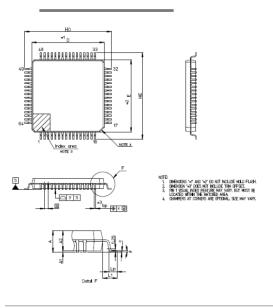

Symbol	Terminology	New	Current
D	Package length	10.0±0.1	10.00±0.20
E	Package width	10.0±0.1	10.00±0.20
A2	Package height	1.4	1.40±0.05
HD	Overall length	12.0±0.2	12.00±0.20
HE	Overall width	12.0±0.2	12.00±0.20
Α	Seated height	1.70max	1.60max
A1	1st standoff height	0.05 to 0.15	0.10±0.05
bp	Terminal width	0.20 +0.07/-0.05	0.22±0.05
С	Terminal thickness	0.09 to 0.20	0.145 +0.055/-0.045
θ	Angle of terminal flat portions	3.5° +4.5°/-3.5°	3° +5°/-3°
е	Terminal pitch	0.5	0.50
х	Tolerance value of terminal center position	0.08max	0.08max
у	Coplanarity	0.08max	0.08max
Lp	Length of soldered part	0.60±0.15	0.60±0.15
L1	Terminal length	1.0	1.00±0.20


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 5



Difference of Appearance_10mm×10mm 64pin

*Character is reference example

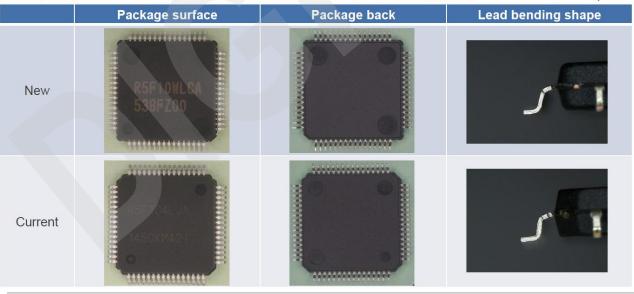


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 6





Difference of Outline Dimension_7mm×7mm 48pin

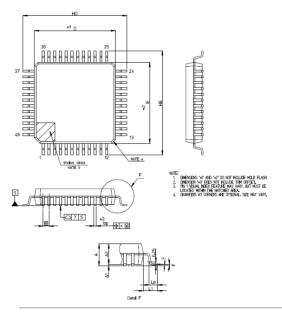

Symbol	Terminology	New	Current
D	Package length	7.0±0.1	7.00±0.20
E	Package width	7.0±0.1	7.00±0.20
A2	Package height	1.4	1.40±0.05
HD	Overall length	9.0±0.2	9.00±0.20
HE	Overall width	9.0±0.2	9.00±0.20
Α	Seated height	1.70max	1.60max
A1	1st standoff height	0.05 to 0.15	0.10±0.05
bp	Terminal width	0.20 +0.07/-0.03	0.22±0.05
С	Terminal thickness	0.09 to 0.20	0.145 +0.055/-0.045
θ	Angle of terminal flat portions	3.5° +4.5°/-3.5°	3° +5°/-3°
е	Terminal pitch	0.5	0.50
х	Tolerance value of terminal center position	0.08max	0.08max
У	Coplanarity	0.08max	0.08max
Lp	Length of soldered part	0.60±0.15	0.60±0.15
L1	Terminal length	1.0	1.00±0.20


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 7



Difference of Appearance_7mm×7mm 48pin

XCharacter is reference example

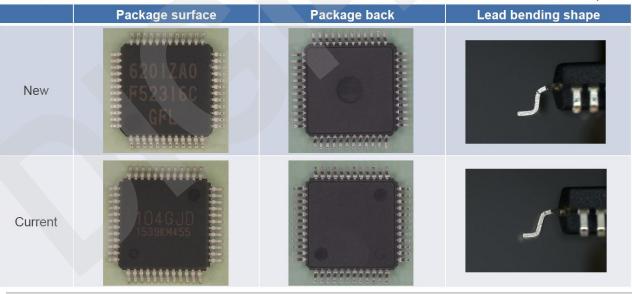


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 8





PKG structure image

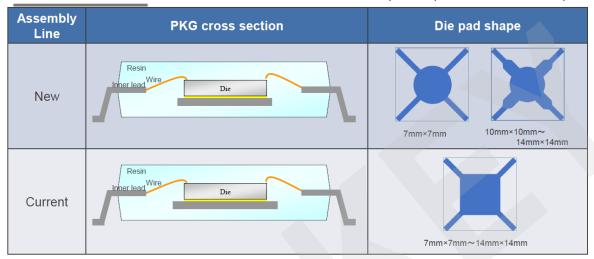

* There is no impact on the reliability by die pad shape

© 2017 Renesas Electronics Corporation. All rights reserved

ページ9



Difference of Marking Visibility

XCharacter is reference example

Assembly Line	New	Current
Whole Photo	R5F10MPED 447FZ00	R5F104PJD 1444KM411 MALAYSIA
Detail Photo		


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 10





Difference of marking

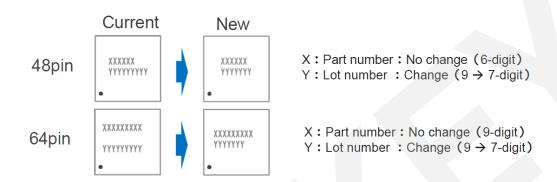


© 2017 Renesas Electronics Corporation. All rights reserved.

Page 11



Difference of marking

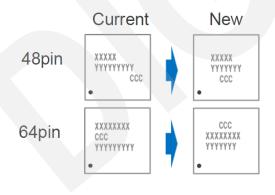

X : Part number : No change (5-digit)

Y: Lot number: Change $(9 \rightarrow 7\text{-digit})$

C: ROM code : No change (3-digit)

X: Part number: Change (Line change) Digit isn't changeC: ROM code: Change (Line change) Digit isn't change

Y: Lot number: Change $(9 \rightarrow 7\text{-digit})$

RENESAS



PACKING SPECIFICATION (Embossed tape)

Storage number:

Only 10mm x 10mm 64pin LQFP embossed tape will be changed. Other packages are unchanged.

	RSKL	RSB
Ordering Part Number	R5F1*RL**FB#X0	R5F1*RL**FB#50
Embossed tape code	E2416Q10RA	+
Storage number	1000 pcs/reel	1500 pcs/reel

Change of desiccant:

Desiccant of embossed tape packing is different with RSKL and RSB.

However, there is no change in the storage term.

	RSKL	RSB
Desiccant		

© 2017 Renesas Electronics Corporation. All rights reserved.

ページ 13



4M changing points

(Addition of wafer fabrication factory)

Process transfer will be performed without change of the basic chip design (chip size, chip patterns).

	Item	Check Result	Judgement
	Machine	The machines are equivalent to current machines.	No risk
Method The same as curren		The same as current products.	No risk
	Man Using operator certification system. Only certificated operator can work the production.		No risk
	Material	The same material is used.	No risk

RENESAS



4M changing points

(Addition of assembly and sorting factory, Change of material)

Item	Check Result	Judgement
Machine	Changing at assembly and sorting. The machines are equivalent to present machines. Copper wire products are produced by same wire-bonding machine applied gold wire. To prevent copper wire oxidization, inert gas is used to wire-bonding process. There are production of similar copper wire products and we have already checked the additional products have no risk on the production.	
Method	Bonding method (thermosonic bonding) and process flow for the Cu wiring are same as the Au wiring.	No risk
Man	Using operator certification system. Only certificated operator can work for the production.	No risk
Material	Using only certificated copper wire. And furthermore certificated materials for the Cu wiring products are applied. The products has been certificated by reliability test same as gold wire products and have no risk.	No risk

© 2017 Renesas Electronics Corporation. All rights reserved.



© 2017 Renesas Electronics Corporation. All rights reserved.

